
New gasket for kit TK5194

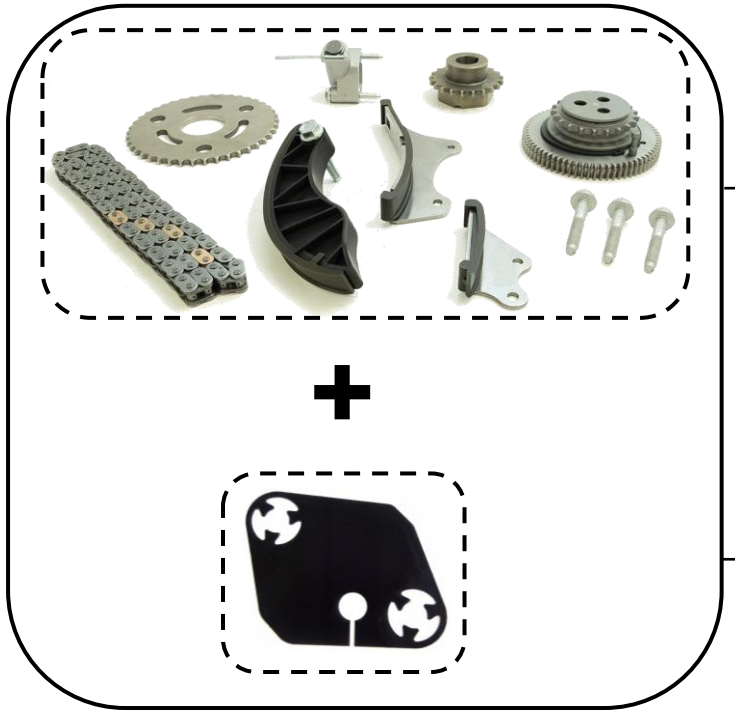

CK5194

Gasket
OE #: 55515025

Issues with Opel 1.6 TCDi engines

What is the problem

Rattling noise, especially when **cold** or during start-up, mainly caused by **loss of timing chain tension**.

Main cause

- **Inefficient hydraulic timing chain tensioner**


The tensioner loses pressure due to oil leaking back into the oil sump.

Consequences

- Repeated starts with the chain not properly tensioned accelerate wear.
- Over time, the noise becomes more frequent and more noticeable.

Solution

The gasket supplied with kit KT5194 is installed between the timing chain tensioner and the engine block to ensure proper sealing and prevent oil leaks. It ensures that oil flow and pressure within the timing system are correctly maintained, preventing oil from escaping and avoiding possible hydraulic tensioner inefficiency.

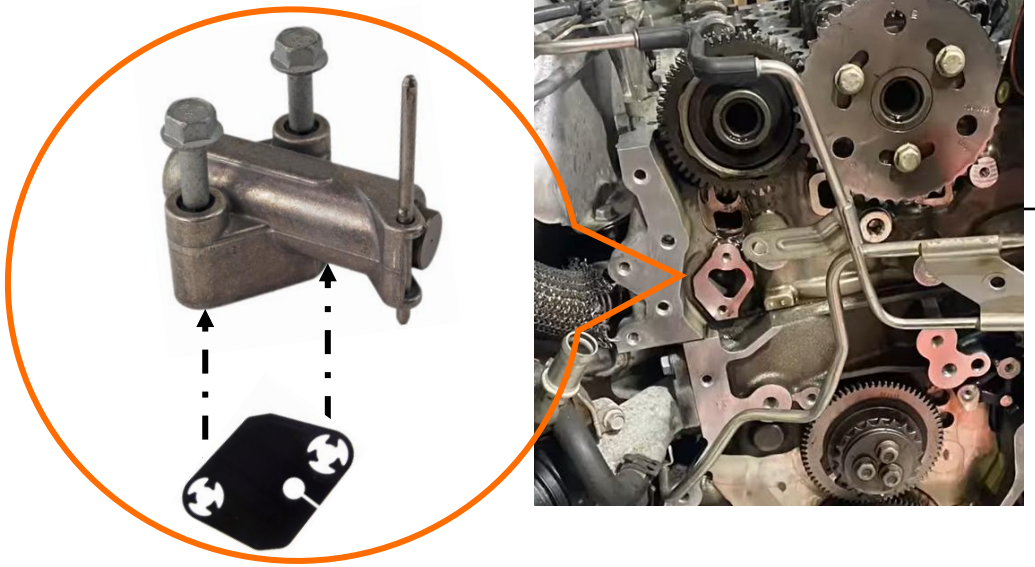

1.6 Tdci Opel engines

Premium water pumps